



Service Advisory

MTD-204

Riders

Affected Models: 13A9A1KN066
 Affected S/N Range: January 26, 2016 thru January 27, 2016 (xA266 thru xA276)
 Date: March 30, 2016
 Subject: Possible Loose EFI Connector at the EFI Module (ECU)
 Purpose: A few of the main wiring harness connectors may have not been fully locked onto the ECU at the time of production on the above listed Affected Model, within the Affected S/N Range.

This Advisory is to be FIX-AS-FAIL

NOTE: These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.
NOTE: Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.
NOTE: Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction

1. Inspect the EFI connector at the ECU, Figure 1, by gently tugging on the connector. If the connector remains attached to the ECU, no further action is required.
2. If the connector comes off, push it back onto the ECU until an audible click is heard, indicating that the locking tab on the connector is correctly seated onto the ECU. After clicked in, again gently tug on the connector to ensure a positive lock.
3. If a positive lock is not achieved, it may be necessary to secure the connector to the ECU with a zip-tie.
4. If using a zip-tie to secure the connector, be sure that the zip-tie does not pinch the wires at the connector.

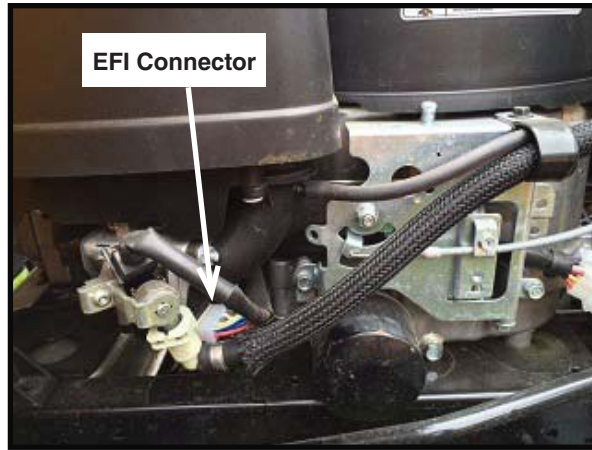


Figure 1

Warranty: Normal warranty terms apply. Indicate Service Advisory **MTD-204** and **751-15194** as the original failed part on the claim. Repair time allowance is **0.25** hours.

Mandatory>>>>When completing the warranty claim, select the drop down text shown below for the following claim fields:

Group Code: Electrical **Fail Code: Electrical Connection**

Work Performed: Wiring Harness (Repair)

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial