



Service Advisory

MTD-206

Riders

Affected Models: 13AQA2KW011 (**Super Bronco 54**), 13WQA2KQ011 (**Super Bronco 50**),
Troy-Bilt 13WQA2KW011 (**Super Bronco 54**)

Affected Models: 14A7A3KW897, (**CGT5426**), 13AQA2KW897 (**CSLT5424**), 13APA1KS897 (**CYT4220SE**),
Columbia 13APA1KT897 (**CYT4622SE**), 13AQA1KQ897 (**CYT5023SE**)

Affected S/N Range: Riders Manufactured September 01, 2014 through March 01, 2016.
(**1I014HXXXXX through 1C016HXXXXX**)

Date: April 11, 2016

Affected Part Numbers: **746-05098, 946-05098, 746-05098A, 946-05098A, 746-05098B & 946-05098B**
Cable - Throttle/Choke 43.5 x 1.6

NOTE: These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.

NOTE: Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.

NOTE: Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction

Purpose: It has come to our attention that the throttle/choke cable used on above listed model tractors, within the specified serial number range, with a twin cylinder Kohler engine, can exhibit a non-start or hard start situation from not being able to achieve full choke. There has been a change made to the throttle/choke cable by increasing the length of the cable throw.

Action Required:

1. If one of the above listed models is experiencing a non-start or hard start situation, check the part number on the throttle/choke cable. If the throttle/choke cable has any of the above listed part numbers affected, order and install a 946-05098C: Throttle/Choke Cable 44.5 x 1.7.
2. All the affected part numbers listed above will sub to the 946-05098C Throttle/Choke Cable 44.5 x 1.7. This is the lengthened version to alleviate the non-start or hard start situation on the above listed model tractors with a twin cylinder Kohler engine.

This Advisory is being released for **INFORMATIONAL** purposes only.