

XT3 ENDURO SERIES

Part Numbers Affected: 746-04759A / 946-04759A Choke Cable
746-04771A / 946-04771A Throttle Cable

Models Affected: XT3-GSX (14BD3LE-010, 14YD3LE-010).

Serial Number Range Affected: Units Manufactured Prior To January 18, 2016

Date: March 08, 2017

Subject: Damaged Throttle and Choke Cables From Heat

MANDATORY REPAIR

NOTE: These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.

NOTE: Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.

NOTE: Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction.

PURPOSE:

We have received reports of the throttle and or choke cables becoming damaged from excessive heat on the above listed models in the Serial Number Range Affected.

ACTION REQUIRED:

1. Check and Identify both throttle and choke cables on all affected Models listed above in the Serial Number Range Affected for the affected cable part number in white on the black casing of the cables. See Figure 1.

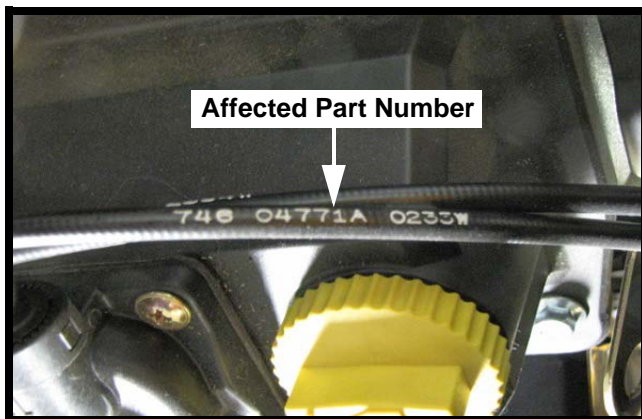


FIGURE 1

2. If the part number on the throttle cable is **746-04771A** and the part number on the choke cable is **746-04759A**. The cables need to be replaced with the revised part numbers, proceed to Step 5.

3. If the part number on the throttle cable is **746-04771A** and the part number on the choke cable is **746-04759A** and the cables are covered with a heat shield sleeve, see Figure 2. No further action is required.

4. If the part number on the throttle cable is **746-04771B** and the part number on the choke cable is **746-04759B**, no further action is required.

NOTE: The heat shield sleeve is Not required with the "B" version cables.

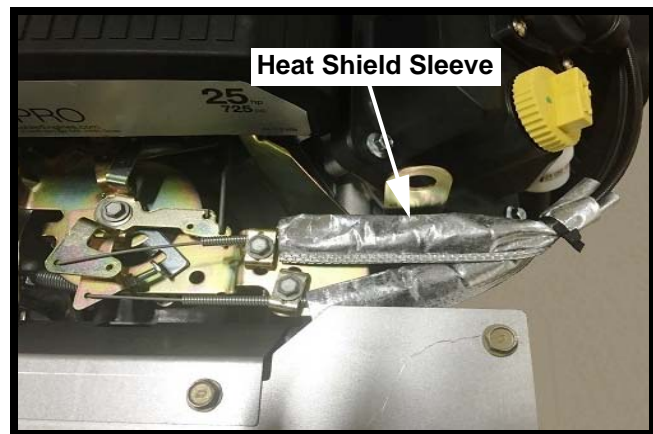


FIGURE 2

5. Order the following from your parts source:

QTY. (1) **946-04771B** Throttle Cable

QTY. (1) **946-04759B** Choke Cable

6. Park the tractor on a flat level surface and set the parking brake.

7. Disconnect the negative battery cable from the negative battery terminal.

8. Remove the existing throttle and choke cables and discard them.

9. Install the revised throttle cable (**746-04771B**) to the throttle control arm and secure loosely in place with the cable clamp. Adjust the cable as needed and tighten the cable clamp. Do not over tighten.

10. Install the revised choke cable (**746-04759B**) to the choke control arm and secure loosely in place with the cable clamp. Adjust the cable as needed and tighten the cable clamp. Do not over tighten.

