

**Part Number Affected:** 726-3046 Ratchet Fastener

**Models Affected:** All Twin and Triple Baggers On All Platforms.

**Serial Number Range Affected:** 2009-2015.

**Date:** July 27, 2015

**Subject:** Replacement Of 726-3046 Ratchet Fastener On Bagger

This advisory is for **INFORMATIONAL PURPOSES ONLY**

**NOTE:** These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.

**NOTE:** Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.

**NOTE:** Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction.

**PURPOSE:**

We have received reports that the **726-3046** ratchet fastener may become loose and fall out. This can cause the upper chute assembly to become disconnected from the discharge chute elbow.


**ACTION REQUIRED:**

If a customer has experienced the above situation or is requesting the **726-3046** ratchet fasteners used in this application, proceed as follows:

1. Order from your parts source the following parts:

- Qty. (2) **738-04502** Shoulder Screw 1/4-20
- Qty. (2) **712-05106** Jam Lock Nut 1/4-20

2. Install the **738-04502** 1/4-20 shoulder screws from the outside of the chute adapter and securely tighten with the **712-05106** 1/4-20 jam lock nuts on the inside of the discharge chute elbow. See Figure 1.

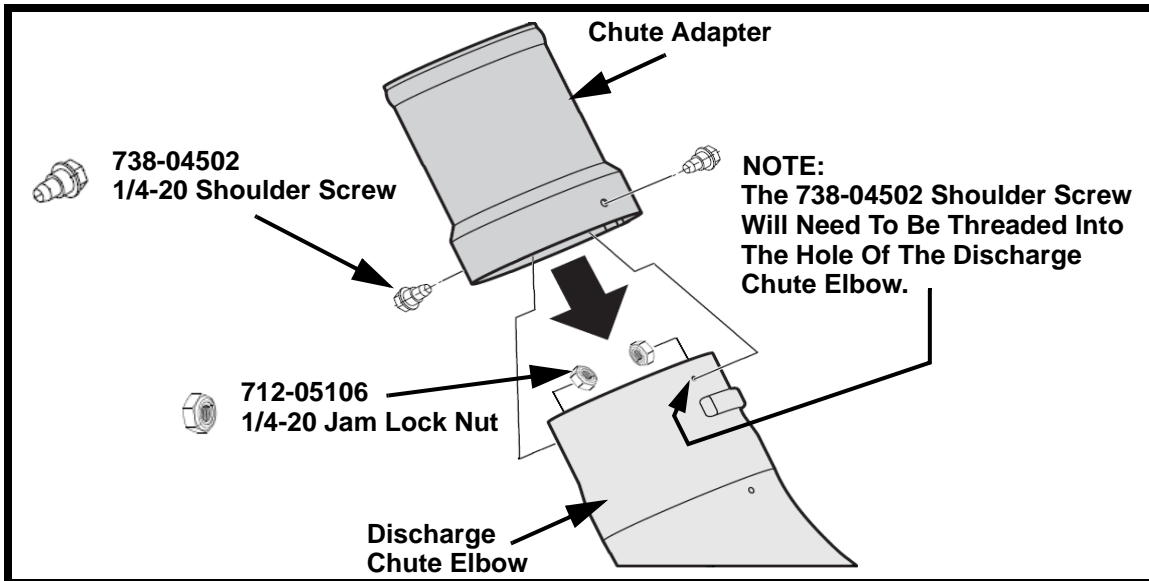

**FIGURE 1**

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial