

ZERO TURN SERIES (Steering Wheel)

Models Affected: 2012 through 2015 Zero Turn Steering Wheel Models.

Parts Affected: **703-08882 / 703-08882A** LH Speed Cam Plate.
703-08883 / 703-08883A RH Speed Cam Plate.

Date: June 30, 2016

Subject: **9.0" Speed Cam Alignment Tool 753-08599.**

INFORMATIONAL ONLY

NOTE: *These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.*

NOTE: *Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.*

NOTE: *Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction.*

PURPOSE:

A change was made to the left hand (**703-08882**) and right hand (**703-08883**) Speed Cam Plates. The new speed cam plates, left hand (**703-083332A**) and right hand (**703-08883A**) require the new 9.0" speed cam alignment tool (**753-08599**) for proper neutral and steering timing procedures.

Service Kit Contents

(See Figure 1)

ITEM NO.	PART NUMBER	QTY	DESCRIPTION
1	N/A	1	9.0 SPD CAM ALIGNBAR
	*	1	THIS INSTRUCTION SHEET

* - Not Available Separately

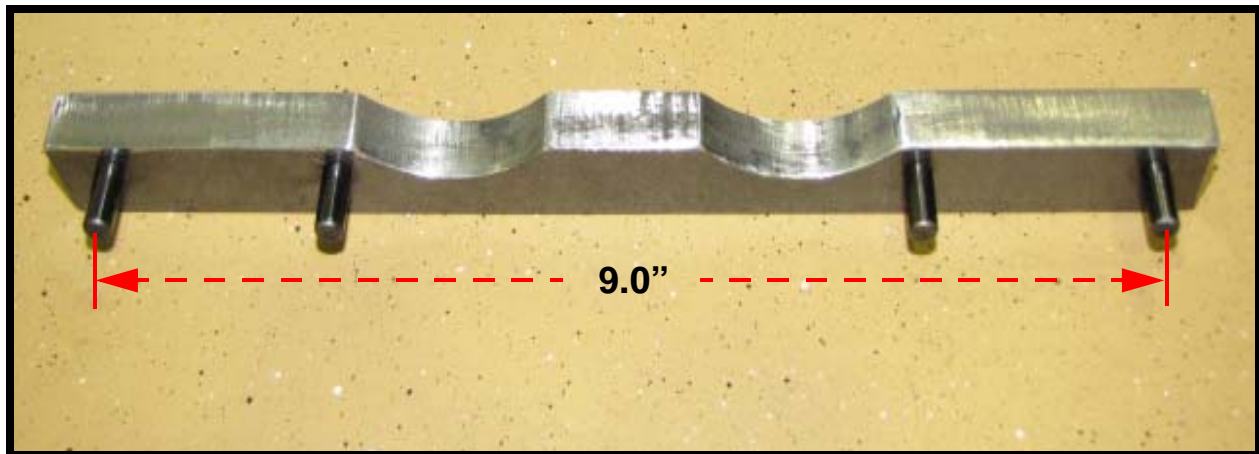


FIGURE 1

This Advisory is being released for informational purposes only.

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial

ACTION REQUIRED:

To identify which speed cam plates are present on a 2012 through 2015 zero turn steering wheel model, measure the dimension from the center of the outer hole of the left hand speed cam plate to the center of the outer hole of the right hand speed cam plate.

The (703-08882) and (703-08883) speed cam plates will measure 8.0". from outer hole to outer hole. These are the production speed cam plates used from 2012 through 2015.

If the speed cam plates have been replaced on a 2012 through 2015 zero turn steering wheel model with the (703-08882A) and (703-08883A) speed cam plates, the speed cam plates will measure 9.0". from outer hole to outer hole as shown in Figure 2.

NOTE: *When replacing one side, the opposite side must be replaced along with it. Can not mix a (703-08882) left hand with a (703-08883A) right hand.*

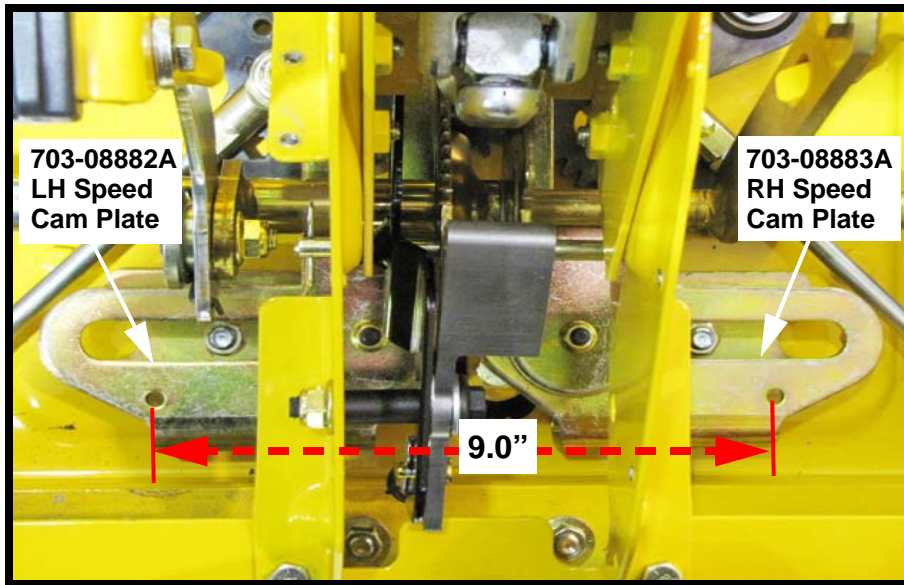


FIGURE 2

THIS AREA LEFT INTENTIONALLY BLANK